



1049 Triad Court
Marietta, Georgia 30062

(770) 423-1400
Fax # (770) 424-6415

SHOCK AND VIBRATION TESTING OF LCD MONITORS

ATS JOB # D145738

Prepared for

HOPE INDUSTRIAL SYSTEMS, INC.
1325 NORTHMEADOW PARKWAY, SUITE 100
ROSWELL, GA 30076

Prepared by _____
David Common, Materials Testing

Approved by _____
Eric Sproat, Materials Testing

This Report May Not Be Reproduced Except In Full

This report represents interpretation of the results obtained from the test specimen and is not to be construed as a Guaranty or Warranty of the condition of the entire material lot.



MATERIALS TEST REPORT

Ref. D145738

Page 1 of 7

Subject

Shock and Vibration testing of LCD monitors

Materials

Two (2) 17" monitors

Objective and Background

Applied Technical Services, Inc. was requested by Hope Industrial Systems, Inc. to perform a shock and vibration test on the supplied monitors using document "HIS Monitor Testing, version 0.92, July 2008" as a guide.

The testing was conducted according the following sections of the document:

- Test 6: Mechanical Shock (operating)
- Test 7: Free-Fall (non-operating)
- Test 10: Random Vibration (non-operating)
- Test 11: Sinusoidal Vibration (operating)

Procedure

Test 6: Mechanical Shock (operating)

Figure 1 shows the setup used for this test.

A video signal was applied to the monitors during the exposure.

100 shocks per axis per direction were applied. Each shock had an amplitude of 15G, a pulse duration of 6ms and ½-sine time waveform. Figure 2 shows representative shocks for this test.

Test 7: Free-Fall (non-operating)

The displays were tested in a packaged configuration.

Each package was dropped onto a concrete floor from a height of 80cm on various faces, edges and corners.

Test 10: Random Vibration (non-operating)

The displays were tested in a packaged configuration.

The packages were placed into a fixture to simulate a shipping environment (see Figure 3).

A random vibration was applied for a duration of 30 minutes per axis over three mutually perpendicular axes.

Figure 4 shows the random vibration profile used (PSD vs. frequency).



MATERIALS TEST REPORT

Ref. D145738

Page 2 of 7

Test 11: Sinusoidal Vibration (operating)

The setup was identical to the setup used for Test 6 (mechanical shock).

A sinusoidal sweep (shown in Figure 5) was applied to the displays along three mutually perpendicular axes.

A total of 10 sweeps per axis was performed.

Equipment used

Thermotron shaker table: ATS-1343 (12/02/2009), Model DS-642-919-H/V

Unholtz-Dickie shaker table: ATS-2259 (12/02/2009), Model R16C

Accelerometer: PCB J320C04, S/N: 9398 (02/16/2010)

Conclusion

The displays provided by Hope Industrial Systems, Inc. were subjected to the shock and vibration tests described in "HIS Monitor Testing, version 0.92, July 2008" for Tests 6, 7, 10 and 11.

The samples were returned to HIS for a functional evaluation.



MATERIALS TEST REPORT

Ref. D145738

Page 3 of 7

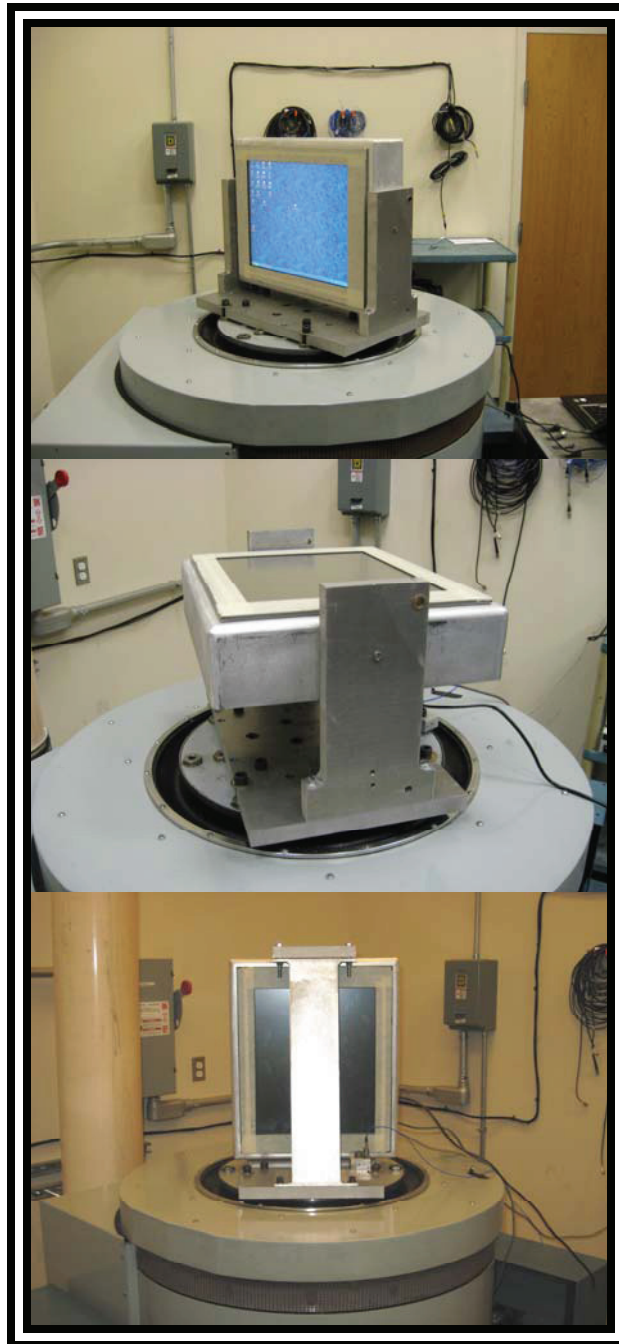


Figure 1: View of the test setup for Test 6 (Shocks) and Test 11 (Sinusoidal Vibration)



MATERIALS TEST REPORT

Ref. D145738

Page 4 of 7

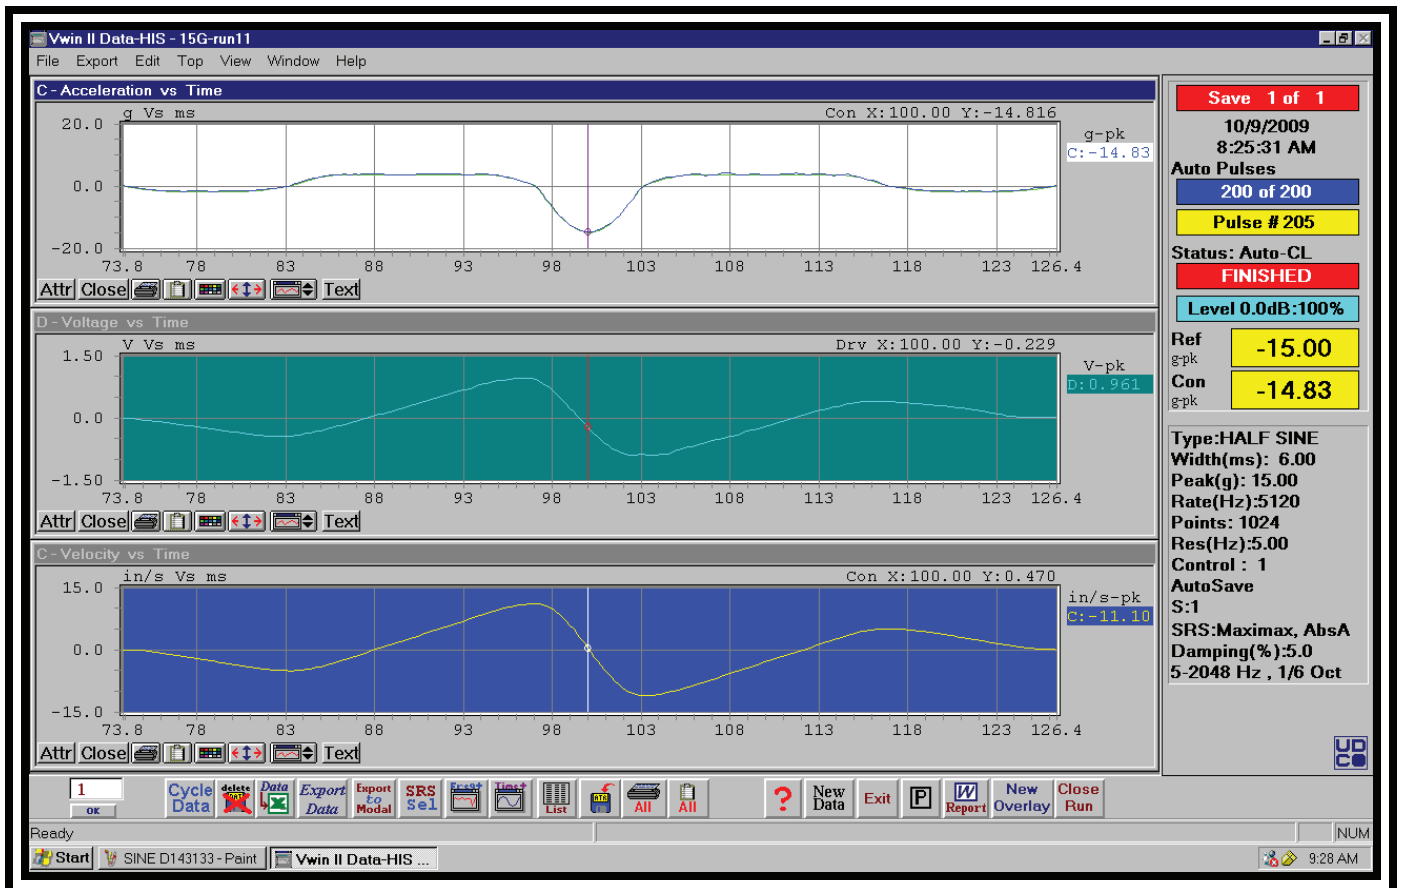


Figure 2: Time history of a representative shock pulse (15G, 6ms, 1/2-sine)



MATERIALS TEST REPORT

Ref. D145738

Page 5 of 7



Figure 3: View of the test setup for Test 10 (random vibration)



MATERIALS TEST REPORT

Ref. D145738

Page 6 of 7

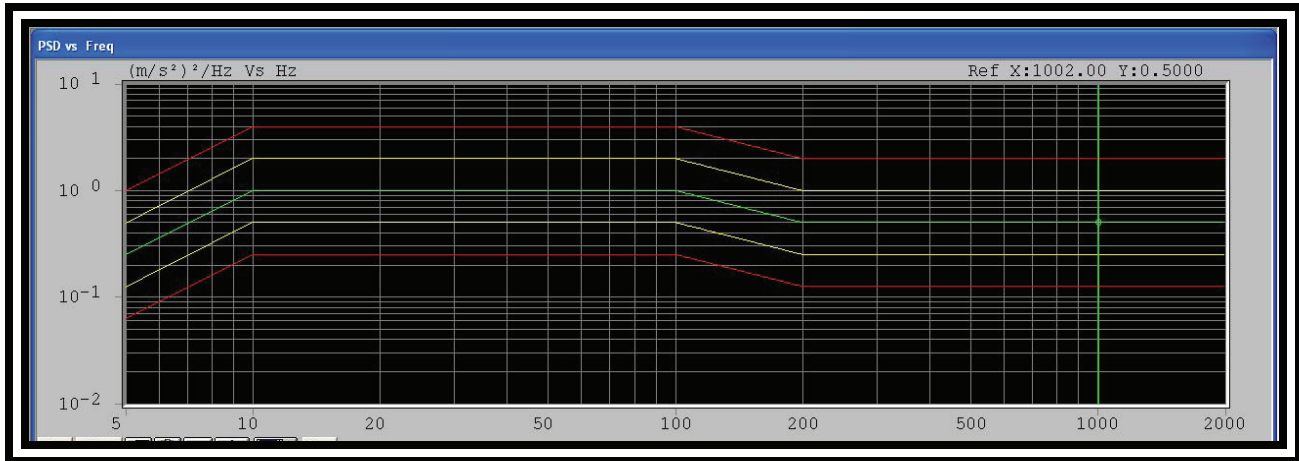


Figure 4: Random vibration profile used for Test 10



MATERIALS TEST REPORT

Ref. D145738

Page 7 of 7

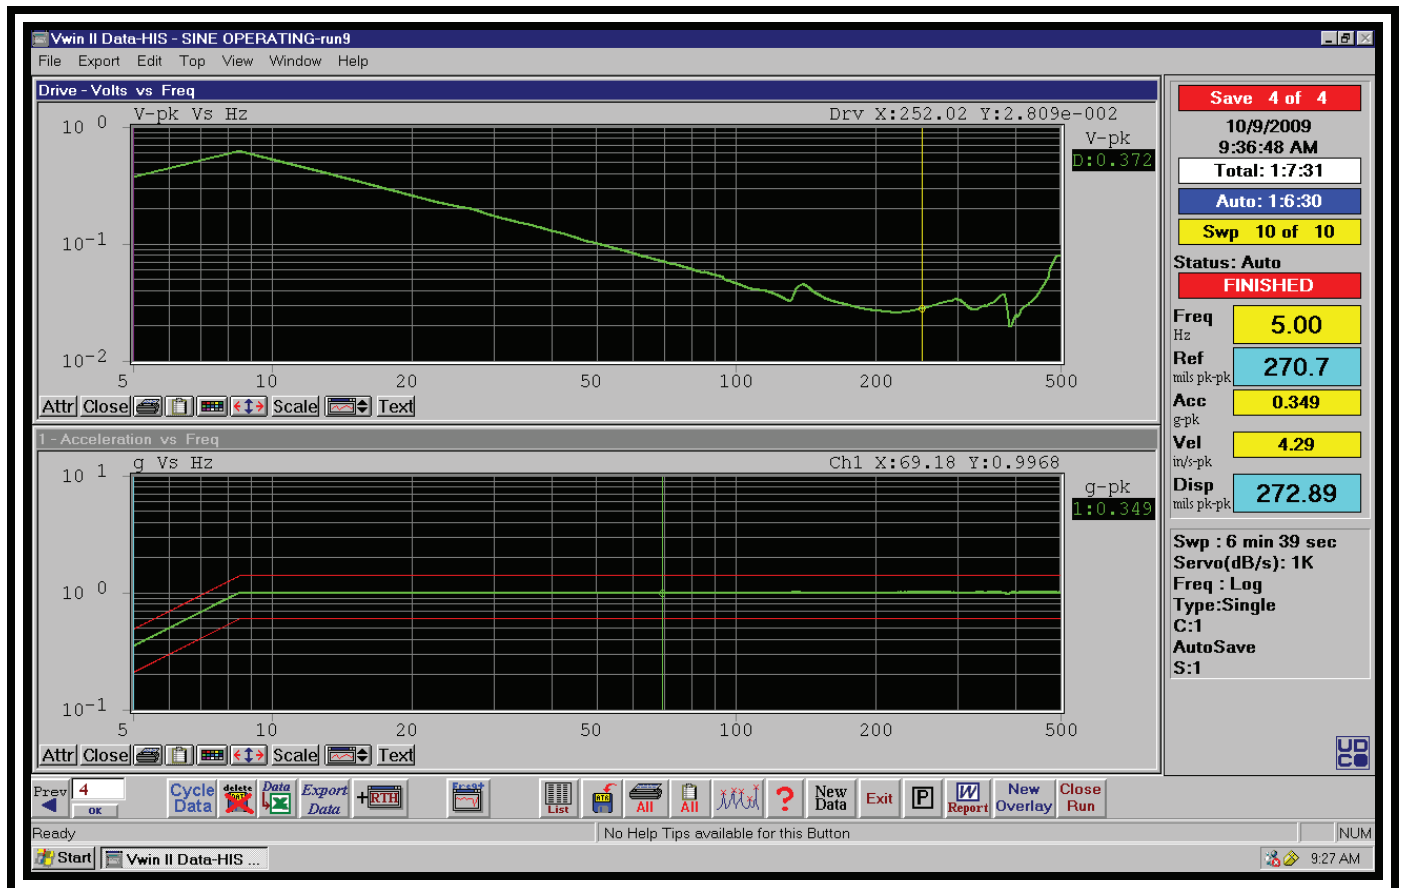


Figure 5: Sinusoidal sweep profile used for Test 11